

M10x1,25x30 - 6ks
M12x30 - 4ks
M12x70 - 2ks (A)
M12x90 - 2ks (I)
M12x19 - 3ks (C)
M12x21 - 1ks (C)




M12 - 6ks (A, I)
M12 - 4ks (C)






PP10 - 6ks
PP12 - 6ks (A, I)
PP12 - 8ks (C)

C

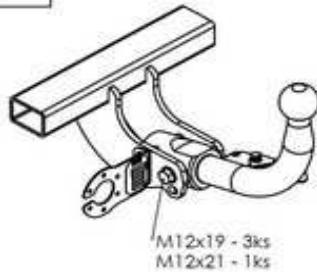

DETAIL

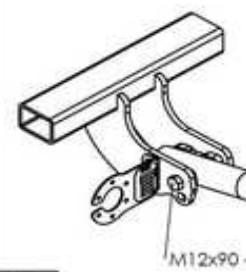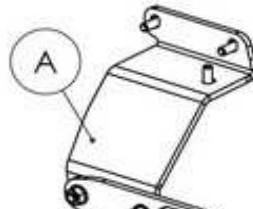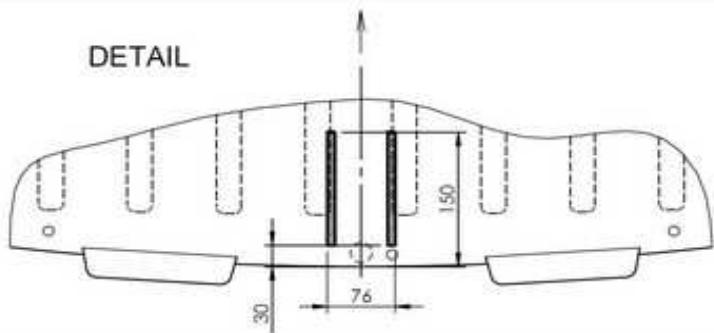

МАГАЗИН



HYUNDAI i30, KIA cee'd
Kód: H0866(A,I,C) 27.7.2012

A

NÁVOD NA MONTÁŽ:

Kód: H0866(A,I,C)

- 1. Uvoľnite výfuk. ■ 2. Demontujte spodný plastový kryt podvozku. Odstráňte pravú a ľavú časť krytu, už sa nepoužijú. Odstráňte vlečné oko. Už sa nepoužije.
- 3. Čažné zariadenie montujte po častiach podľa obrázka. Čažné zariadenie montujte bez gule a puzdra C. Na upevňovacie otvory zľahka priskrutkujte postranné pátky A a B, na ne naskrutkujte rám čažného zariadenia C. Skrutkové spoje dotiahnite momentom podľa tabuľky. Vyrežte vybranie v spodnom plastovom kryte podľa obrázka – DETAIL, nie v náraďníku. Tento kryt namontujte späť s príspôsobením k priečinku čažného zariadenia. ■ 4. Elektroinstaláciu zapojte podľa návodu.
- 5. Skontrolujte správnosť pripojenia elektroinstalácie. ■ 6. Prevedte spätnú montáž demontovaných častí. ■ 7. Dotiahnite skrutkové spoje spojovacej gule (držiaka spojovacej gule) momentom podľa tabuľky.

FITTING INSTRUCTIONS:

- 1. Loosen the exhaust. ■ 2. Remove the under plastic surfacing for chassis. Remove the left and right part of the cover. It will not be used. Remove the towing eye. It is not. ■ 3. Install the tow-bar in parts to picture. Install the tow-bar without towball and case C. Freely screw the side base A and B on the fixing holes and then screw the frame of the tow-bar C on it. Then tighten the screw connections by the torque table. Cut out the removal in to the under plastic cover – picture detail, not in to the bumper. Mount this cover back up with acclimation to the transom of the tow bar. ■ 4. Connect the electrical installation as described in the instructions for use. ■ 5. Make sure the electrical installation is properly connected. ■ 6. Reassemble any removed parts. ■ 7. Make sure the screws of the linkage ball (holder of the linkage ball) are tightened to the torque shown in the table.

DÔLEŽITÉ UPOZORNENIA:

- V miestach stykových plôch sa musí odstrániť pružná ochrana karosérie vozidla.
- Vŕtané otvory treba ošetriť antikoróznnou hmotou.
- Použite len dodaný spojovací materiál v predpisanej triede kvality.
- Elektrické zariadenie sa namontuje podľa podmienok prevádzky cestných vozidiel na pozemných komunikáciach.
- Údaj S o maximálnom zvislom zaťažení na gulu je uvedený na výrobnom štítku čažného zariadenia.
- Na čažnom zariadení nie je možné nič upravovať ani meniť.
- Pred ukončením montáže je nutné prekontrolovať všetky spoje podľa tabuľky utáhovacích momentov!
- V prípade akýchkoľvek nejasností je nutné obrátiť sa na výrobcu čažného zariadenia.
- Výrobca nenesie zodpovednosť za škody spôsobené nesprávnym použitím výrobku.

IMPORTANT ATTENTIONS:

- Remove insulating material on a car body in grips and joints of a coupling device with a car body.
- Put the anticorrosive substance on the drilled holes.
- Use supplied mechanical strength jointing material.
- Wiring of a coupling device must be up to a standard and car maker requirements.
- Statement S about the maximum vertical ball downtime is printed on the tow bar label.
- On the tow bar is no modification possible
- Check all the joints, look in the table of the spinning moments, before finishing the montage!
- Contact the tow bar marker with any questions.
- The manufacturer is not responsible for the damages caused by wrong using on the product.

Tabuľka utáhovacích momentov skrutkových spojov pevnosti 8.8 / Table of specified torque and hardenss settings 8.8

M6 - 9,5Nm, M8 - 23Nm, M10 - 46Nm, M10x1,25 - 49Nm, M12 - 79Nm, M12x1,25 - 87Nm, M12x1,5 - 83Nm, M14 - 125Nm, M16 - 195Nm